
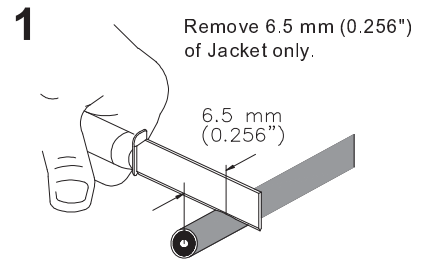



Installation Instructions

Connector Attachment


For Braided Cable CNT-400 & C2FP
TNC Male, Captivated Pin,
Clamp-type Body: 400PTM-C (400PTM-C-NK)

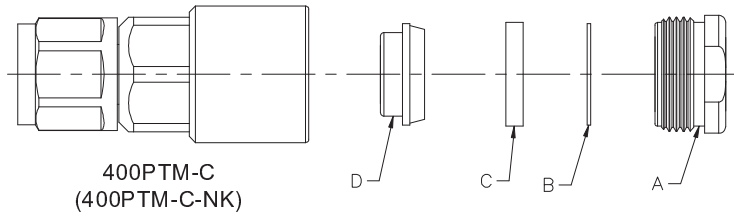


2 Slide parts A, B, C onto the cable. Note: the direction of part C as shown.

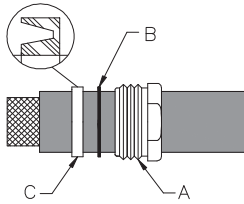


3 Comb braid straight with a wire brush.

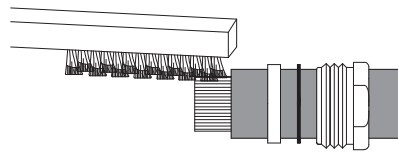


4 Install part D as shown without damaging the braid.

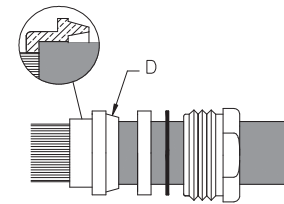


5 Fold braid around part D and comb braid as shown, the braid should be straight and equally spaced after comb.

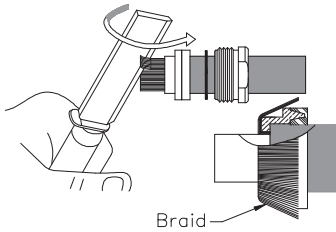


6 Cut off the redundant braid as shown.

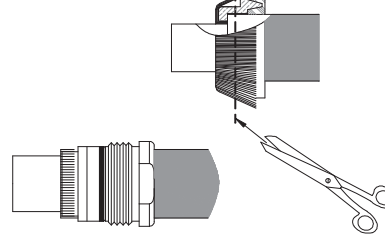


7 Remove 5.0 mm (0.197") of foam. Remove all foam/glue residue from the center conductor.

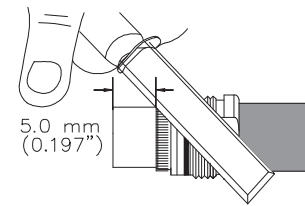

8 Chamfer the center conductor at a 45° angle.

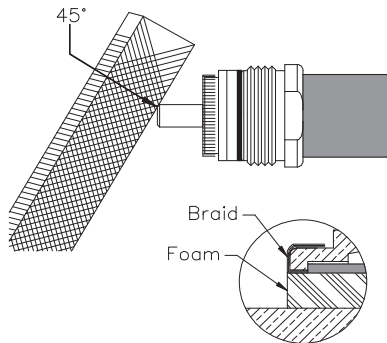

9 The cable attachment must be straight and aligned with the hole of connector inner contact. Insert the cable attachment into the connector body until stopped; the center conductor must be inserted into the connector inner contact fingers. Tighten the connection to the torque value of 44-53 lb-in (5.0-6.0 Nm). Note: Do not turn connector body, turn clamp nut attachment.

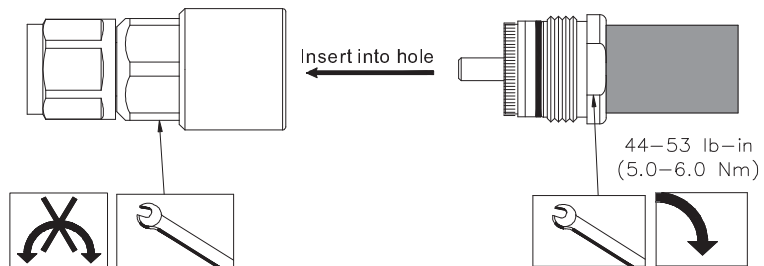

	表一 有毒有害物质或元素名称及含量标识格式					
	有毒有害物质或元素					
部件名称 (Part Name)	铅 (Pb)	汞 (Hg)	镉 (Cd)	六价铬 (Cr6+)	多溴联苯 (PBB)	多溴二苯醚 (PBDE)
连接器 (Connector)	X	O	O	O	O	O

O: 表示有毒有害物质在该部件所有的均质材料中的含量均在SJ/T 11363-2006规定的限量要求以下。
X: 表示该有毒有害物质至少在该部件的某一均质材料中的含量超出SJ/T 11363-2006规定的限量要求。



Installation Training Available at Andrew Institute

Notice: Andrew disclaims any liability or responsibility for the results of improper or unsafe installation, inspection, maintenance, or removal practices

Andrew Corporation

3 Westbrook Corporate Center, Suite 900, Westchester, Illinois U.S.A. 60154
+1 (708) 349-3300 Fax (U.S.A.): 1-800-349-5444

www.andrew.com

Copyright © 2007 by Andrew Corporation

Customer Service, 24 hours

U.S.A., Canada, Mexico: 1-800-255-1479
U.K.: 0800 250055

Other Europe: +44 592 782 612

